

APPENDIX I

SOME PHOTOGRAPHS TAKEN DURING THE JOINT INVESTIGATION VISIT



FIG 1: Installed 2 1/2" valve on the facility



FIG 2-3: Incident Facility repaired and Aqua wrapped



FIG 4: Backfilled Incident Point