

PICTURES TAKEN DURING THE JOINT INVESTIGATION VISIT



FIG. 1: SHOWING THE INSTALLED 2" VALVE BEFORE REPAIR WORK



FIG.2: SHOWING THE PIPELINE AFTER REPAIRS